



## Technical Service Information Bulletin

May 2, 1997

Title:

MIL 'ON' – P0116 SET IN MEMORY (ECM)

Models:

'97 LX 450

ENGINE  
EG004-97

### Introduction

Some '97 LX450s may exhibit a MIL "ON" condition (DTC code P0116 – "engine coolant temperature malfunction") under certain normal operating conditions. To improve the operating logic of the coolant temperature circuit, the engine ECM has been changed.

#### NOTE:

When diagnosing a vehicle with this condition, check all related components according to the Repair Manual. If all parts pass testing, the ECM logic may be too sensitive and require replacement.

### Production Change Information

- The new ECM was installed in production after VIN JT6HJ88\*\*V0169421.

### Parts Information

PREVIOUS PART NUMBERS	NEW PART NUMBER	PART NAME
89661-60650	89661-60652	Module, Engine Control
89661-60651		

