

TOYOTA TECHNICAL SERVICE BULLETIN

REF.: ENGINE

NO.: EG004-96


DATE: DECEMBER 20, 1996

MODEL: L-C


Title: **LAND CRUISER (1FZ-FE) THERMOSTAT GASKET LEAK**

Page 1 of 1

To improve sealing performance of the Thermostat Gasket after engine starting in extreme low ambient temperatures, the shape of the gasket has been changed as shown.

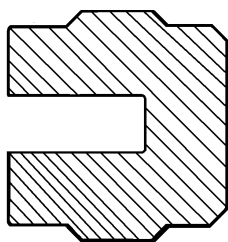

Previous

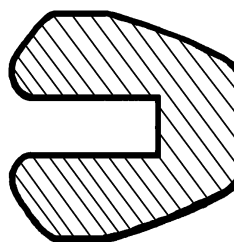

New

PRODUCTION EFFECTIVE:

VIN	ENGINE
JT3HJ85**T0144383	0242556

PARTS INFORMATION:

PREVIOUS PART NUMBER	NEW PART NUMBER	PART NAME	QTY
16346-17010	16346-66020	Gasket, Thermostat	1

NOTE: Use only the New Part Number for Land Cruiser (1FZ-FE). Previous Part Number will remain available for other applications.

WARRANTY INFORMATION:

OPCODE	DESCRIPTION	TIME	OPN	T1	T2
161101	1FZ-FE Thermostat Gasket	0.7	16346-17010	66	51

Applicable Warranty Coverage: 3 Years or 36,000 Miles